



## Штревели AZB

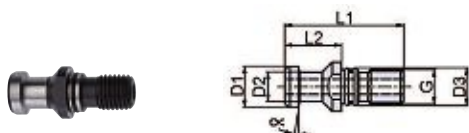


Штревели AZB DIN 69872-A с внутренним отверстием

Обозначение	Номер для заказа	L1	L2	D1	D2	D3	G	$\alpha$	Для крутых конусов
AZB30-DIN-A	2910300	44	24	13	9	13	M12	15°	30
AZB40-DIN-A	2910500	54	26	19	14	17	M16	15°	40
AZB50-DIN-A	2910700	74	34	28	21	25	M24	15°	50

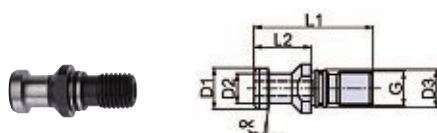


Штревели AZB DIN 69872-B без внутреннего отверстия

Обозначение	Номер для заказа	L1	L2	D1	D2	D3	G	$\alpha$	Для крутых конусов
AZB30-DIN-B	2911300	44	24	13	9	13	M12	15°	30
AZB40-DIN-B	2911500	54	26	19	14	17	M16	15°	40
AZB50-DIN-B	2911700	74	34	28	21	25	M24	15°	50

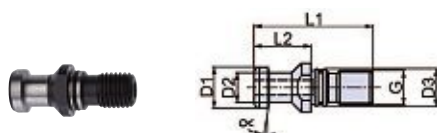

Штревели AZB ISO 7388/II-B с внутренним отверстием


Обозначение	Номер для заказа	L1	L2	D1	D2	D3	G	$\alpha$	Для крутых конусов
AZB40-ISO-A	2920500	44,5	16,4	18,95	12,95	17	M16	45°	40
AZB50-ISO-A	2920700	65	25,5	29	19,6	25	M24	45°	50

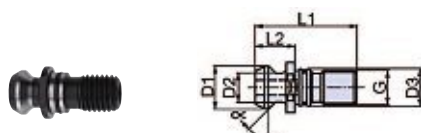

Штревели AZB ISO 7388-B без внутреннего отверстия


Обозначение	Номер для заказа	L1	L2	D1	D2	D3	G	$\alpha$	Для крутых конусов
AZB40-ISO-B	2921500	44,5	16,4	18,95	12,95	17	M16	45°	40
AZB50-ISO-B	2921700	65	25,5	29	19,6	25	M24	45°	50

# Штревели AZB

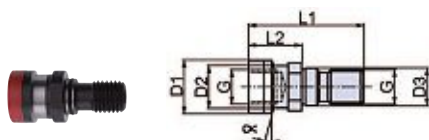


Штревели AZB DIN 2080 с внутренней резьбой

Обозначение	Номер для заказа	L1	L2	D1	D2	D3	G	α	Для крутых конусов
AZB40-DIN 2080-G	2943500	53	25	25	21,6	17	M16	15°	40
AZB50-DIN 2080-G	2943700	65	25,1	39,3	32	25	M24	15°	50

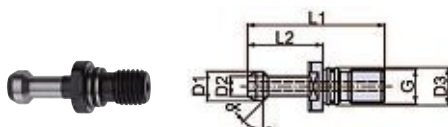


Штревели AZB MAS/VT 45° (JIS B 6339) с внутренним отверстием

Обозначение	Номер для заказа	L1	L2	D1	D2	D3	G	α	Для крутых конусов
AZB30-VT-45°-A	2930300	43	23	11	7	12,5	M12	45°	30
AZB40-VT-45°-A	2930500	60	35	15	10	17	M16	45°	40
AZB50-VT-45°-A	2930700	85	45	23	17	25	M24	45°	50

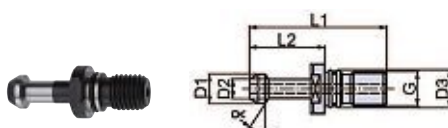

Штревели AZB MAS/VT 30° (JIS B 6339) с внутренним отверстием


Обозначение	Номер для заказа	L1	L2	D1	D2	D3	G	α	Для крутых конусов
AZB30-VT-30°-A	2931300	43	23	11	7	12,5	M12	30°	30
AZB40-VT-30°-A	2931500	60	35	15	10	17	M16	30°	40
AZB50-VT-30°-A	2931700	85	45	23	17	25	M24	30°	50

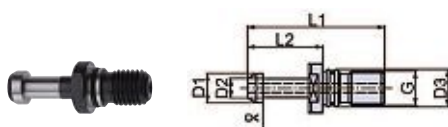

Штревели AZB MAS/VT 90° (JIS B 6339) с внутренним отверстием


Обозначение	Номер для заказа	L1	L2	D1	D2	D3	G	α	Для крутых конусов
AZB30-VT-90°-A	2932300	43	23	11	7	12,5	M12	90°	30
AZB40-VT-90°-A	2932500	60	35	15	10	17	M16	90°	40
AZB50-VT-90°-A	2932700	85	45	23	17	25	M24	90°	50

## Штревели AZB

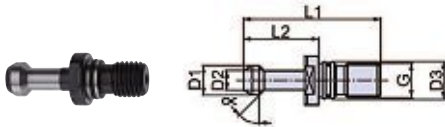


Штревели AZB MAS/BT 45° (JIS B 6339) без внутреннего отверстия

Обозначение	Номер для заказа	L1	L2	D1	D2	D3	G	α	Для крутых конусов
AZB30-BT-45°-B	2933300	43	23	11	7	12,5	M12	45°	30
AZB40-BT-45°-B	2933500	60	35	15	10	17	M16	45°	40
AZB50-BT-45°-B	2933700	85	45	23	17	25	M24	45°	50

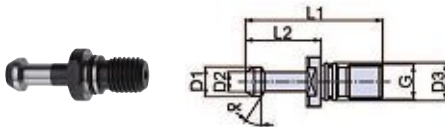

Штревели AZB MAS/BT 30° (JIS B 6339) без внутреннего отверстия

Обозначение	Номер для заказа	L1	L2	D1	D2	D3	G	α	Для крутых конусов
AZB30-BT-30°-B	2934300	43	23	11	7	12,5	M12	30°	30
AZB40-BT-30°-B	2934500	60	35	15	10	17	M16	30°	40
AZB50-BT-30°-B	2934700	85	45	23	17	25	M24	30°	50

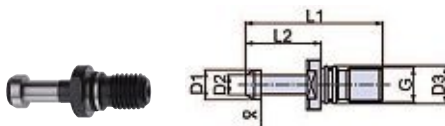

Штревели AZB MAS/BT 90° (JIS B 6339) без внутреннего отверстия

Обозначение	Номер для заказа	L1	L2	D1	D2	D3	G	α	Для крутых конусов
AZB30-BT-90°-B	2935300	43	23	11	7	12,5	M12	90°	30
AZB40-BT-90°-B	2935500	60	35	15	10	17	M16	90°	40
AZB50-BT-90°-B	2935700	85	45	23	17	25	M24	90°	50